

Courtesy Safety Notice: AustriAlpin COBRA® buckles


Fulpmes, 14 January 2016

Dear valued clients,

it has come to our attention that in an extremely small quantity ($0.0000005\% = 1$ out of 2 million) of COBRA® buckles there may exist parts where the rivets have **not** been **press fixed**.


This results in the rivets being loose and the release clips detach. COBRA® buckles in all different versions and sizes can be affected. As we are dedicated to the 100% function, performance, quality and safety of our products, we ask all our clients and end users of COBRA® buckles to **do a visual check**:

Correct

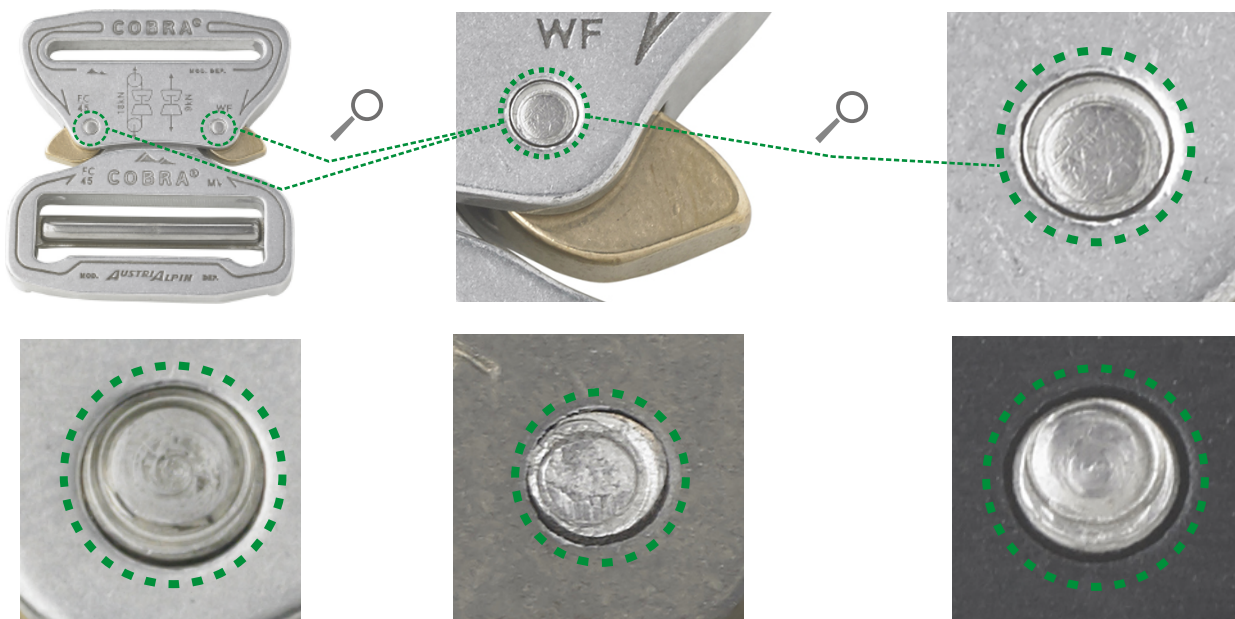

The rivet shows an embossing in the form of a ring on both the front and back sides of the rivet. Do not manipulate the rivets by mechanical action.

NOT Correct

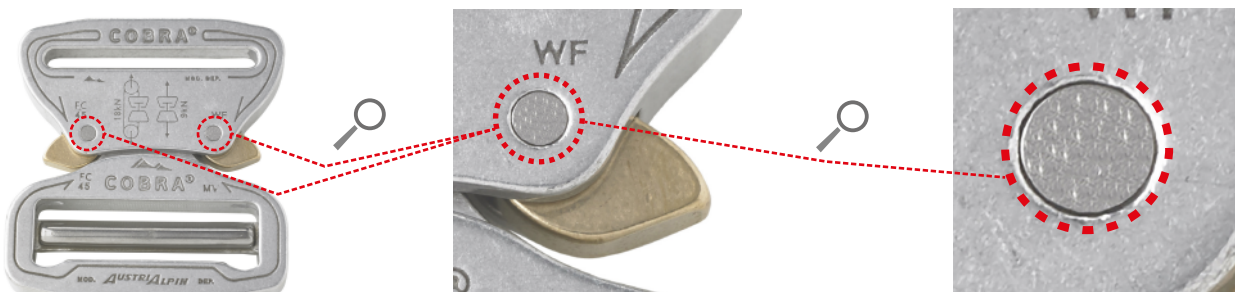

The rivet does not show any circular embossing.

If you notice a buckle that is NOT riveted or you do have any concerns, STOP USING the product immediately and get in contact with us: office@austrialpin.at or via phone +43 522 56 52 48

We would like to apologize for the inconvenience and are kindly asking for your understanding.