

Date	October 2022
Product	Kontainer V4
Level	Lox



**KORTEL
DESIGN**



SAFETY NOTE

OBJET :

Problème sur le fourreau guide des élévateurs sur le Kontainer V4.



Description :

Following a pilot's feedback during the installation of his rescue parachute in the V4 Kontainer, and after checking that it was working properly, it was found that a slight defect in the riser guide sleeve could lead to damage to the equipment in the event of the rescue parachute being used in a real situation.

***There is no risk to the correct deployment of the rescue parachute,
but there is a risk that the risers may not exit the sheath correctly.***

KORTEL DESIGN

1096 Av. André Lasquin – 74700 SALLANCHES – France

Tél : +33(0)9.50.10.73.27 - @info@korteldesign.com – www.korteldesign.com

Date	October 2022
Product	Kontainer V4
Level	Lox



**KORTEL
DESIGN**

Procedure :

To correct the defect, simply :


- Open the Kontainer V4 and view the central area where the sleeve is connected via Velcro.



- Cut off the "short" part of the zip that protrudes from the sleeve with a scissor.



- Check that the zip is flush with the sleeve, and that the slider can remain in place on the other side when the zip is fully closed.

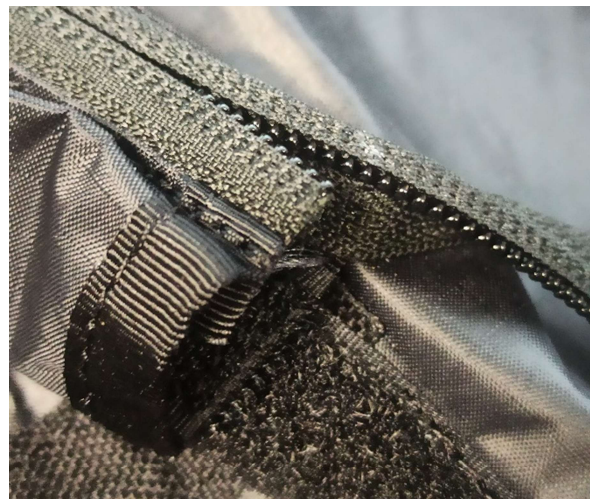

KORTEL DESIGN

1096 Av. André Lasquin – 74700 SALLANCHES – France

Tél : +33(0)9.50.10.73.27 - @info@korteldesign.com – www.korteldesign.com